

SECTION 1: IDENTIFICATION OF THE SUBSTANCE/PREPARATION AND COMPANY/UNDERTAKING

Product identifier

Product name: AIRCO Marvel 162

Other means of identification

Product code: 237

Recommended use of the chemical and restrictions on use

Recommended use: General purpose brazing flux

Details of the supplier of the safety data sheet

Manufacturer: Force Industries Division.
28 Industrial Blvd. Paoli, PA 19301.

Emergency Telephone number

For hazardous materials incidents only, call CHEMTREC Emergency Response Number:

1-800-424-9300.

For all other inquiries about this product, call Force Industries Division at 610-647-3575.

Revision Date: July 20, 2016

Supersedes: January 4, 2016

SECTION 2: HAZARDS IDENTIFICATION

2.1 Classification of the substance or mixture

GHS Classification in accordance with 29 CFR 1910 (OSHA HCS)

Eye irritation (Category 2A) H319

Reproductive toxicity (Category 1B), H360

Acute aquatic toxicity (Category 3), H402

Chronic aquatic toxicity (Category 3), H412

For the full text of the H-Statements mentioned in this Section, see Section 16. Classification


Hazard statement(s)

H319 Causes serious eye irritation.

H360 May damage fertility or the unborn child.

H361 Suspected of damaging fertility or the unborn child.

H412 Harmful to aquatic life with long lasting effects.

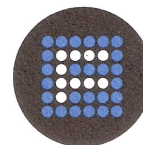

2.2 GHS Label elements, including precautionary statements

Emergency overview

Appearance: Fine, white powder
Physical state: Solid
Odor: None
Signal Word: Danger



Precautionary statement(s)

P201: Obtain special instructions before use.
 P202: Do not handle until all safety precautions have been read and understood.
 P264: Wash skin thoroughly after handling.
 P273: Avoid release to the environment.
 P280: Wear eye protection/ face protection.
 P281: Use personal protective equipment as required.
 P305+P351+P338: IF IN EYES: Rinse cautiously with water for several minutes. Remove contact lenses, if present and easy to do. Continue rinsing.
 P308 + P313: IF exposed or concerned: Get medical advice/ attention.
 P337+P313: If eye irritation persists: Get medical advice/ attention.
 P405: Store locked up.
 P501: Dispose of contents/ container to an approved waste disposal plant.


2.3 Hazards not otherwise classified (HNOC) or not covered by GHS

None

SECTION 3: COMPOSITION / INFORMATION ON INGREDIENTS

<u>Component</u>	<u>CAS No.</u>	<u>EINECS No.</u>	<u>Weight %</u>
Boric acid	10043-35-3	233-139-2	50-90
Sodium tetraborate	1330-43-4	215-540-4	10-50

Others, if any, are non-hazardous and claimed as trade secret.

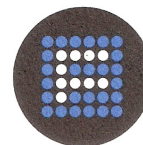

SECTION 4: FIRST AID MEASURES

4.1 Description of first aid measures

General advice

Consult a physician. Show this safety data sheet to the doctor in attendance.

Eyes: Rinse thoroughly with plenty of water for at least 15 minutes and consult a physician.

Skin: Wash off with soap and plenty of water. Consult a physician.

Ingestion: Never give anything by mouth to an unconscious person. Rinse mouth with water. Contact physician.

Inhalation: If breathed in, remove person to fresh air and keep at rest in a position comfortable for breathing. If breathing is difficult, give oxygen. If not breathing, give artificial respiration. Consult a physician.

4.2 Most important symptoms and effects, both acute and delayed

The most important known symptoms and effects are described in the labeling (see section 2.2) and/or in section 11.

4.3 Indication of any immediate medical attention and special treatment needed

No data available

SECTION 5: FIRE-FIGHTING MEASURES

5.1 Extinguishing media

Use water spray, alcohol-resistant foam, dry chemical or carbon dioxide.

5.2 Special hazards arising from the substance or mixture


Borane/boron oxides

5.3 Advice for firefighters

In the event of fire, wear self-contained breathing apparatus.

5.4 Further information

No data available.

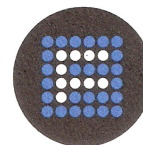

SECTION 6: ACCIDENTAL RELEASE MEASURES

6.1 Personal precautions, protective equipment and emergency procedures

Wear respiratory protection. Avoid dust formation. Avoid breathing vapors, mist or gas. Ensure adequate ventilation.

Evacuate personnel to safe areas. Avoid breathing dust.

For personal protection see section 8.

6.2 Environmental precautions

Do not let product enter drains. Discharge into the environment must be avoided.

6.3 Methods and materials for containment and cleaning up

Pick up and arrange disposal without creating dust. Sweep up and shovel. Keep in suitable, closed containers for disposal.

6.4 Reference to other sections

For disposal see section 13.

SECTION 7: HANDLING AND STORAGE

7.1 Precautions for safe handling


Avoid formation of dust and aerosols. Provide appropriate exhaust ventilation at places where dust is formed. For precautions see section 2.2.

7.2 Conditions for safe storage, including any incompatibilities

Keep container tightly closed in a dry and well-ventilated place. Moisture sensitive. Storage class (TRGS 510): Non-combustible, acute toxic Cat.3 / toxic hazardous materials or hazardous materials causing chronic effects

7.3 Specific end use(s)

Apart from the uses mentioned in section 1.2 no other specific uses are stipulated.

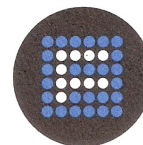

SECTION 8: EXPOSURE CONTROLS/PERSONAL PROTECTION

8.1 Control parameters

Components with workplace control parameters

Component	CAS-No.	Value	Control parameters	Basis
Boric acid	10043-35-3	TWA	2 mg/m ³ (as borate compounds)	ACGIH Threshold Limit Values (TLV)
Sodium tetraborate	1330-43-4	TWA	2 mg/m ³	ACGIH Threshold Limit Values (TLV)

8.2 Exposure controls

Appropriate engineering controls

General industrial hygiene practice.

Personal protective equipment

Eye/face protection

Safety glasses with side-shields. Use equipment for eye protection tested and approved under appropriate government standards such as NIOSH (US) or EN 166(EU).

Skin protection


Handle with gloves. Gloves must be inspected prior to use. Use proper glove removal technique (without touching glove's outer surface) to avoid skin contact with this product. Dispose of contaminated gloves after use in accordance with applicable laws and good laboratory practices. Wash and dry hands.

Body Protection

Impervious clothing. The type of protective equipment must be selected according to the concentration and amount of the dangerous substance at the specific workplace.

Respiratory protection

If mist or vapor is release use an air-purifying respirator with dust mist filter. Use respirators and components tested and approved under appropriate government standards such as NIOSH (US) or CEN (EU).

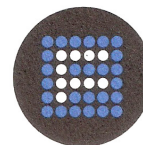

Control of environmental exposure

Do not let product enter drains. Discharge into the environment must be avoided.

SECTION 9: PHYSICAL AND CHEMICAL PROPERTIES

9.1 Information on basic physical and chemical properties

Physical state:	Fine Powder
Odor:	No data available
Color:	White
Flash point:	No data available
Vapor pressure:	No data available
Vapor density:	No data available
Specific gravity:	1.62
Water solubility:	Moderate

9.2 Other safety information

None

SECTION 10: STABILITY AND REACTIVITY

10.1 Reactivity

No data available

10.2 Chemical stability

Stable under recommended storage conditions

10.3 Possibility of hazardous reactions

No data available

10.4 Conditions to avoid

Avoid moisture.


10.5 Incompatible materials

Potassium, Acid anhydrides

10.6 Hazardous decomposition products

Other decomposition products – no Reactivity

No dangerous reaction known under conditions of normal use

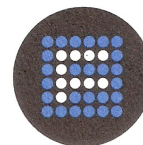

SECTION 11: TOXICOLOGICAL INFORMATION

11.1 Component toxicity

Components	LD50/Rabbit (Dermal)	LD50/Oral/Rat
Boric acid	No Data	2,660 mg/kg
Sodium tetraborate	2,000 mg /kg	2,600 mg/kg

Reproductive toxicity

In animal testing, risk of impaired fertility was shown only after administration of very high doses of this substance

Skin corrosion/irritation

Skin - Rabbit
Result: No skin irritation

Serious eye damage/eye irritation

Eyes - Rabbit
Result: Moderate eye irritation (OECD Test Guideline 405)

Respiratory or skin sensitization

Buehler Test - Guinea pig
Result: Does not cause skin sensitization. (OECD Test Guideline 406)

Germ cell mutagenicity

No data available

Chronic Toxicity and Carcinogenicity

IARC: No component of this product present at levels greater than or equal to 0.1% is identified as probable, possible or confirmed human carcinogen by IARC.
NTP: No component of this product present at levels greater than or equal to 0.1% is identified as a known or anticipated carcinogen by NTP.
OSHA: No component of this product present at levels greater than or equal to 0.1% is identified as a carcinogen or potential carcinogen by OSHA.

Carcinogenicity:


No data available

Developmental Toxicity

No data available

Reproductive Toxicity

For the minor component(s): In animals, effects have been reported on the following organs: Male reproductive organs. Repeated excessive exposures to high amounts may cause effects on testes and fertility in males.

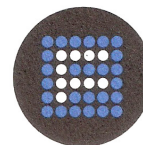

Genetic Toxicology

Based on information for component(s): In vitro genetic toxicity studies were negative. Animal genetic toxicity studies were negative.

Specific target organ toxicity - single exposure

No data available

Specific target organ toxicity - repeated exposure

No data available

Aspiration hazard

No data available

Additional Information

Toxicity reported for borates in humans: ingestion or absorption may cause nausea, vomiting, diarrhea, abdominal cramps, and erythematous lesions on the skin and mucous membranes. Other symptoms include: circulatory collapse, tachycardia, cyanosis, delirium, convulsions, and coma. Death has been reported to occur in infants from less than 5 grams and in adults from 5 to 20 grams. Liver - Irregularities - Based on Human Evidence Liver - Irregularities - Based on Human Evidence

Animal feeding studies in rat, mouse and dog, at high doses, have demonstrated effects on fertility and testes. Studies with the chemically related boric acid in the rat, mouse and rabbit, at high doses, demonstrate developmental effects on the fetus, including fetal weight loss and minor skeletal variations. The doses administered were many times in excess of those to which humans would normally be exposed. Human epidemiological studies show no increase in pulmonary disease in occupational populations with chronic exposures to boric acid dust and sodium borate dust. A recent epidemiological study under the conditions of normal occupational exposure to borate dusts indicated no effect on fertility.

SECTION 12: ECOLOGICAL INFORMATION

12. ECOLOGICAL INFORMATION

12.1 Toxicity


Toxicity to fish

LC50 - *Ptychocheilus lucius* - 279 mg/l - 96 h

LC50 - *Lepomis macrochirus* (Bluegill) - > 1,021 mg/l - 96 h

LC50 - *Limanda limanda* - 74 mg/l - 96 h

SAFETY DATA SHEET

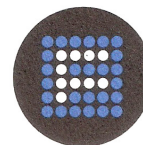

FORCE
INDUSTRIES
DIVISION

Toxicity to daphnia and other aquatic invertebrates

LC50 - Daphnia magna (Water flea) - 53.2 mg/l - 21 d

EC50 - Daphnia magna (Water flea) - 133 mg/l - 48 h.

12.2 Persistence and degradability

No data available

12.3 Bio-accumulative potential

No data available

12.4 Mobility in soil

No data available

12.5 Results of PBT and vPvB assessment

PBT/vPvB assessment not available as chemical safety assessment not required/not conducted

12.6 Other adverse effects

No data available

SECTION 13: DISPOSAL CONSIDERATIONS

13.1 Waste treatment methods

Product

Contact a licensed professional waste disposal service to dispose of this material. Dissolve or mix the material with a combustible solvent and burn in a chemical incinerator equipped with an afterburner and scrubber. Offer surplus and non-recyclable solutions to a licensed disposal company.

Contaminated packaging

Dispose of as unused product.

SECTION 14: TRANSPORT INFORMATION

DOT (US)

Not dangerous goods

IMDG

Not dangerous goods

IATA

Not dangerous goods



SECTION 15: REGULATORY INFORMATION

International Inventories

USA (TSCA): Complies

Federal Regulations**SARA Title III 313 Reportable Substances**

This material does not contain any chemical components with known CAS numbers that exceed the threshold (De Minimis) reporting levels established by SARA Title III, Section 313.

SARA Title III Section 311/312 Hazard Categories:

Chronic Health Hazard

Toxic Substance Control Act (TSCA)

If listed below, non-proprietary substances are subject to export notification Section 12 (b) of TSCA:

None

State Regulations (RTK)Massachusetts Right To Know Components

Component	CAS No.
Sodium tetraborate	1330-43-4

Pennsylvania Right to Know Components

Component	CAS No.
Boric acid	10043-35-3
Sodium tetraborate	1330-43-4

New Jersey Right to Know Components

Component	CAS No.
Boric acid	10043-35-3
Sodium tetraborate	1330-43-4



California Proposition 65

This product does not contain any chemicals known to State of California to cause cancer, birth defects, or any other reproductive harm.

SECTION 16: OTHER INFORMATION

Full text of H-Statements referred to under sections 2 and 3.

Aquatic Acute	Acute aquatic toxicity
Aquatic Chronic	Chronic aquatic toxicity
H319	Eye Irritant. Eye irritation Causes serious eye irritation.
H360	May damage fertility or the unborn child.
H361	Suspected of damaging fertility or the unborn child.
	Reproductive toxicity
H402	Harmful to aquatic life.
H412	Harmful to aquatic life with long lasting effects.

HMIS:

Health: 2*

Flammability: 0

Reactivity: 0

PREPARATION INFORMATION: Technical Service Department,
Force Industries Division

DISCLAIMER: The data set forth in these sheets are based on information provided by the suppliers of the raw materials and chemicals used in the manufacture of the aforementioned product. Force Industries makes no warranty with respect to the accuracy of the information provided by their suppliers, and disclaims all liability of reliance thereon. Force Industries warrants only that its products conform to their published specifications and no other express warranty is made with regards thereof. We do not guarantee favorable results, and we assume no liability in connection with the use of the products. They are intended for use by persons having technical skill and knowledge, at their own discretion and risk.